WickGun™ Braid Dispenser — Model 1000

The desoldering system that fits in the palm of your hand.

Loading

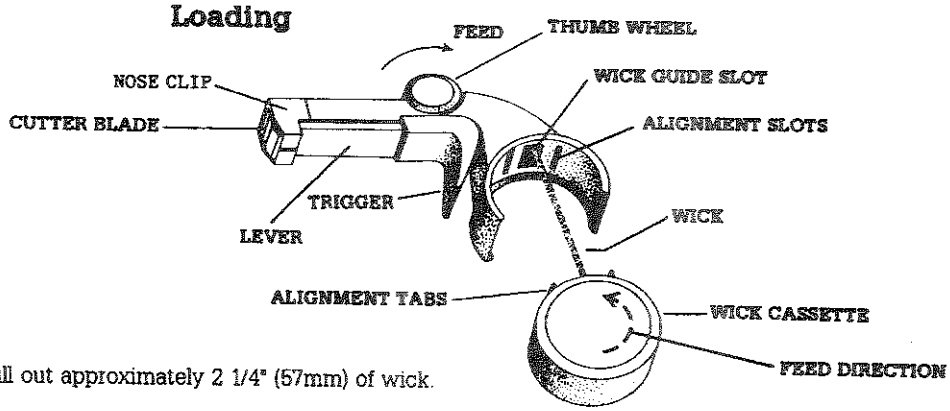

Important:
With WickGun™ pointing left, insert cassette with label facing up so wick will feed from right. (counter clockwise)

1. Grasp cassette and pull out foam plug, then pull out approximately 2 1/4" (57mm) of wick.

2. Insert wick into guide slot. Rotate thumb wheel in feed direction while seating cassette. Ensure wick is not pinched between cassette and WickGun™ and that cassette alignment tabs are seated in the alignment slots in the gun.

3. If wick fails to feed, disengage cassette, grasp wick and pull from wick guide slot. Do not allow cassette to unwind. Eliminate any kinks and/or frayed wick and repeat steps 1 & 2.

Operating Instructions

1. Hold with thumb on thumb wheel and index finger over trigger.

2. Rotate thumb wheel in feed direction exposing 3/4" to 1" (19mm to 25mm of wick). Do not press on trigger while dispensing wick.

3. Perform desoldering operation.

4. Squeeze trigger to cut off filled wick. **Caution — to prevent jamming, do not retract wick more than ¼" to ½" (6mm to 12mm) or the solder saturated wick past cutting blades.**

Replacing the Cutter

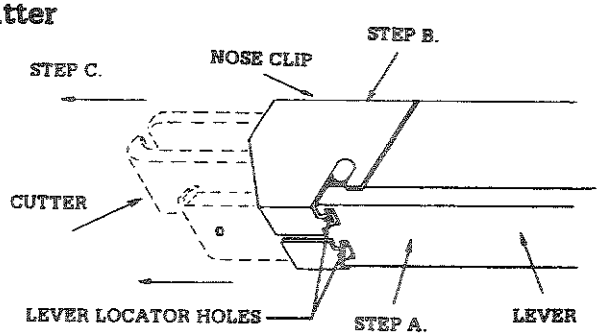

1. To remove cutter:

   A. remove lever by pressing up and sliding forward.
   B. slide nose clip up, then out to disengage.
   C. slide cutter out through front.

2. To install new cutter:

   A. slide in cutter inserting feed tube through slot in back.
   B. slide lever into place. Nose clip tabs must be seated in lever locator holes. Compress cutter with appropriate object pushed through small hole in lever to facilitate this step.

3. To maintain good cutting action, periodically remove blades and clean with flux solvent. AVOID contact between solvent and plastic parts.

Replacement Parts

W4015-1 — replacement cassette with 15' (4.57 m) #1 braid — width 0.035" (0.9mm)
W4015-2 — replacement cassette with 15' (4.57 m) #2 braid — width 0.060" (1.5mm)
W4015-3 — replacement cassette with 15' (4.57 m) #3 braid — width 0.085" (2.2mm)
W4015-4 — replacement cassette with 15' (4.57 m) #4 braid — width 0.115" (2.9mm)
W10010 — replacement cutter

XURON CORPORATION, 60 Industrial Park Road, Saco, Maine 04072 Tele: (207) 283-1401 Fax: (207) 283-0594